

This is another interior crack.

Aug 4, 2008 13:22




This crack is probably thermal related. The concern with these stone walls there is no rebar to hold the walls together when under stress such as settlement, impact or seismic activity.

Aug 4, 2008 13:19



I was told this heater is not used which is good as its clearance to combustibles is not adequate.

Aug 4, 2008 13:22

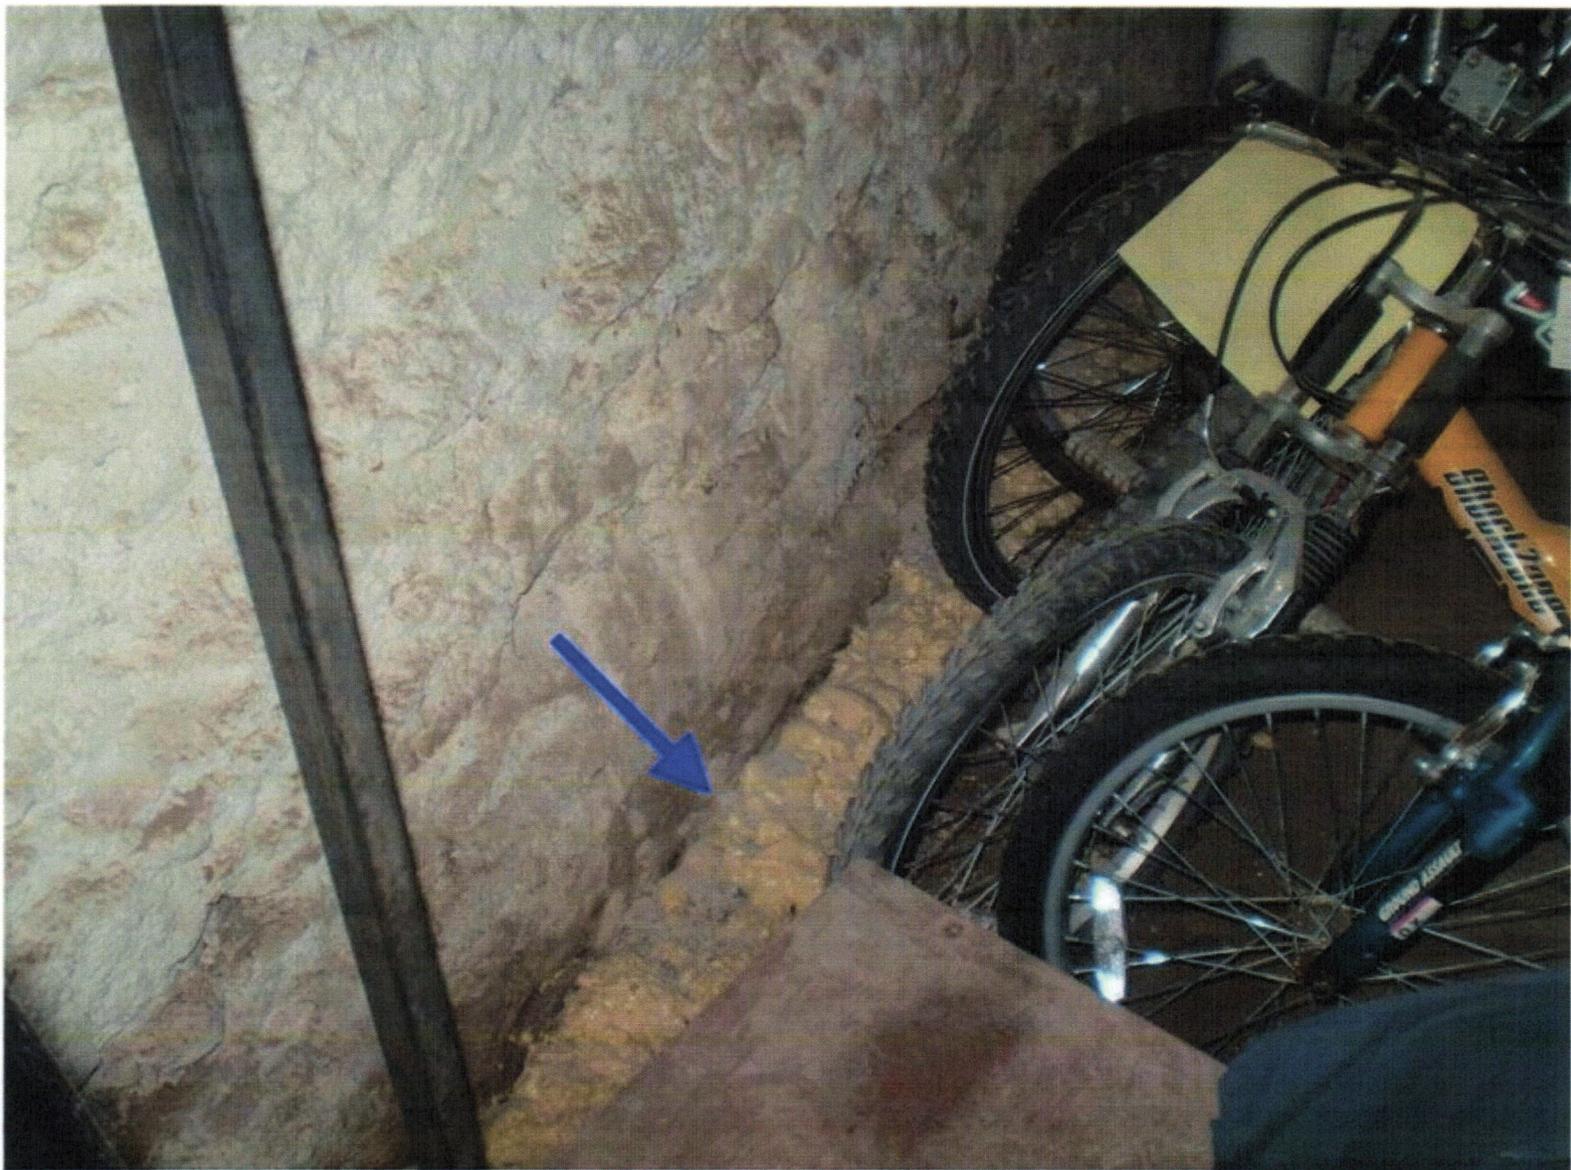

The arrow shows expanding foam that has been used to plug air infiltration. Aug 4, 2008 13:23



This is a general view of the attic. The light colored trusses are spaced about 12 feet and the original purlins (boards between) were originally 2X6's. The sagging of the roof indicates to me that the sagging includes some of the trusses being lower than others.



There has been repairs to the roof by sistering 2X8 boards to the original 2X6 pulins.

Aug 4, 2008 13:27